

LAND CORNER RECORD

Index: R-9	Corner: Section corner common to Section 20, 21, 28, & 29	State of Indiana - Hoosier National Forest		
Section: 21	Township: 7N	Range: 1E	P.M.: 2nd	County: Monroe
Coordinate:	Lat./N: 1374374.52	Lon./E: 3139997.38	Datum: NAD83(2011) US survey feet	

CORNER HISTORY: (Chronological history of corner)

1.) Date of Survey:	Surveyor:	Monument:	Recording Information:		Monument Photograph:
1814	Arthur Henrie	Wood post	Original Govt. Notes		
Reference Objects:	Species:	Diameter:	Bearing:	Distance:	
	White Oak	30"	S81°E	9 links	
	Black Oak	18"	N61°W	9 links	
Record evidence of prior survey:					
2.) Date of Survey:	Surveyor:	Monument:	Recording Information:		
10/11/2009	Kevin Enright	3" Brass Disk	Monroe Co. Surveyor Tie Sheet		
Reference Objects:	Species:	Diameter:	Bearing:	Distance:	
	Mag Nail/Red Oak	18"	N10°E	43.47'	
	Sign in Red Oak	10"	N77°E	20.52'	
	Sign in Red Pine	13"	S39°E	15.12'	
Record evidence of prior survey:	Found 3" Brass Disk				

ACCESSORIES: Bearing and distance from monument to witness object.

Reference Objects:	Object or Tree Species:	Diameter:	Bearing:	Distance:
	Mag nail in Pignut Hickory	21"	N78°W	14.12'
	Mag nail in Black Oak	11"	N77°E	20.80'
	Mag nail in Pignut Hickory	10"	S0°W	28.89'
	Sign in dying Red Pine	10"	S39°E	15.0'
Monument Found or Set:	Found a 3" galvanized pipe with stamped brass cap on top, 0.4' above grade			


MONUMENT SKETCH



NARRATIVE REFERENCE:

Monument is a 3" galvanized pipe with stamped brass cap on top, 0.4' above grade, a carsonite post is located approximately 2' south of the monument. Monument is located on the northeast edge of a SE to NW ridge top, on the north edge of a pine stand. North and west fence corners at a hickory tree approximately 15' to west of monument.

SECTION DIAGRAM

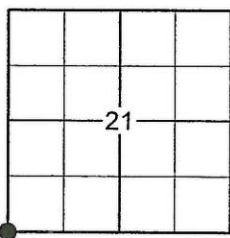

Corner Location = ●

PERPETUATION RECORD:

Per a USFS Land Corner Record dated 11-10-2003 (on file in the USFS office), this monument was set in 1978 by the USFS, replacing a stone. The stone is shown on an unsigned USFS survey (c.1980) showing a breakdown of Section 21 (on file in the USFS office), and is shown on the hand drawn sketch of Section 21 by Ken Anderson, dated 11-23-1982 (on file in the USFS office).

The record monument was found undisturbed and maintained by remarking the existing bearing trees or establishing new bearing trees. One existing bearing tree was recovered from a 11/24/2003 Land Corner Record and remarked. One existing bearing tree was recovered from a 11/24/2003 Land Corner Record and determined to be dying and was not remarked. Two new bearing trees were established.

Bearing Trees were marked with a blaze, scribed B.T., bearing tree sign, paint, and nail where permission was granted by adjoining landowner.

Section: 21 T7N R1E

Prepared By: BRG (Project#3-565)

Date: 6/2015

Referenced on BRG survey recorded as InstNo.2016001724

Accepted by the Monroe County Surveyor Review Board on August 6, 2019.

MONUMENT RECORD
State of Indiana - County of Monroe

Section: 20

Township: 7 North


Range: 1 East

Corner ID: Polk I-17

Monument Description & Remarks: 3" Brass Disk 6" above ground. Survey Sign 5ft above ground at pt. B

References On File: Andrew J. Sobiech certified land corner restoration, Monument Record (1975); and recovery tie drawing, Monument Record (1974), on file in Surveyor Office

RECOVERY TIE DRAWING
Field Book 39 Page No. 20

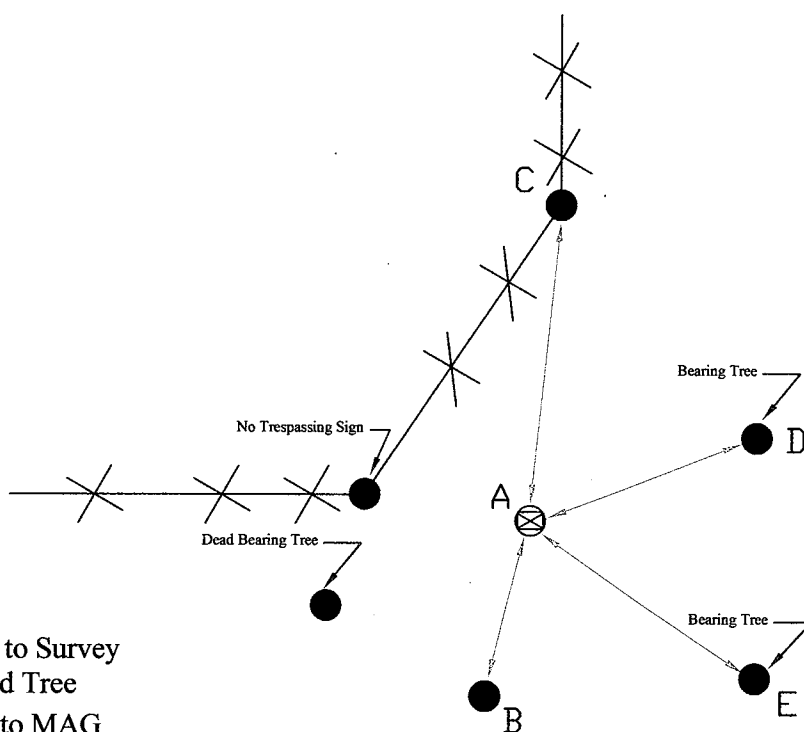


A - 3" Brass Disk
B - S 18° W 11.92' to Survey Sign in 3" Dogwood Tree
C - N 10° E 43.47' to MAG nail in 18" Red Oak
D - N 77° E 20.52' to Bearing Sign in 10" Red Oak
E - S 39° E 15.12' to Bearing Sign in 13" Red Pine

Not To Scale
Compass Bearing Magnetic North



I, Kevin P. Enright, Monroe County Surveyor, hereby certify that this document was prepared under my direction in accordance with the provisions of section 36-2-12-11 of the Indiana Code; and the above data is given under my hand and seal this 3rd day of April, 2007.

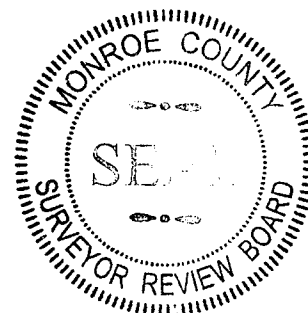

Administered by the Monroe County Surveyor Review Board

Date: 10/11/2009

Index: R-9	Corner: S.C.	LAND CORNER RECORD		State of Indiana Hoosier National Forest	
Twnshp: 7N	Range: 1E	Section: 20,21,28,29	2 nd P.M.	County: Monroe	
EXISTING SURVEYS					
Original Government Survey			Original Survey Evidence Found		
Year Surveyed: 1814	By: Arthur Henrie	Date of Search:	By:		
Original Monument: Woodpost	Species		Diameter	Bearing	Distance
W.Oak	30"	S 81°E	9 links		
B. Oak	18"	N 61°W	9 links		
Subsequent Corner Restoration			Evidence of Subsequent Corner Restoration Found		
Where Filed or Recorded:	Year Searched: 11/10/03	By: B. Stone			
Book:	Monument Found:	3" diameter steel pipe FS monument with a 3" diameter brass cap standing 5" above ground and stamped as shown.			
Monument Set:	Date:				
Species	Diameter	Bearing	Distance	Species	Diameter

OTHER EVIDENCE

Describe corner loc. relative to nearby features & dir. to corner location; note fences, roads, etc.	Sketch of Monument
The monument is on the northeast edge of a southeast to northwest broad flat ridgetop on the north edge of a Pine stand. There are several downed and dead pines on the ridgetop next to the monument and extending to the southeast. A cleared area on private land on the ridgetop is approximately 300 feet west. A west and north running fence fence corners in a 19" Hickory N 78° W 14.4 feet. The Hickory has a white 'No Trespassing' sign with faded red letters. An old decaying wooden 4" x 4" post painted red with faded, rusty, metal 'Land Survey Monument' sign is S 33° W 8.6 feet. When walking into the monument from Hardin Ridge road stay on the southwest side of the ridgetop after passing the pond. This will get you around the downed trees. Upon nearing the west edge of the downed trees turn to the north. * A corner certificate note indicates the monument was set in 1978, replacing a sandstone with a + on top.	

PERPETUATION RECORD

Monument: Describe new monument set or work done to perpetuate/preserve the existing monument/position.					
					
Corner Diagram		Accessories: Describe new BTs & witness objects established to perpetuate existing evidence.			
		All Bearing Trees had new tags nailed over old ones in 1997			
		R.Oak (with healed 11" over blaze)	Pine (with blaze) 12"	Pine (with blaze) 10"	
		N 75°E	S 40° E	S 40°W	
		20.8 Ft.	15.0 Ft.	20.6 Ft.	
Corner Recordation:		Certificate Prepared:			
Filed and Recorded in County records:		Date:			
Book:		Page:			
Section: 20		Geodetic Coordinates: Lat./N.		Long./E.	
Edited By: Robert J. Stone		Date Created:		11/24/03	

Index No R-9 LAND CORNER RECORD FSM 7150
 T. 7N R. 1E 2nd P.Mer. County MONROE State of Indiana
S.P. Corner common to Sections 20, 21, 28 and 29 Hoosier National Forest

EXISTING SURVEYS

Original Government Survey					Original Survey evidence Found				
Year Surveyed	By				Date of Search	By			
Original Monument					Monument Found				
Species	Dia	Bearing	Dist		Orig. Species	Dia	Bearing	Dist	
BT's					BT's				
					Found				
Subsequent Corner Restoration					Evidence of Subsequent Corner Restoration Found				
Date Surveyed	By				Date of Search	By			
Where Filed or recorded:					Monument Found				
Book:	Page								
Monument Set									
BT's Species	Dia	Bearing	Dist		Species	Dia	Bearing	Dist	
Ref.					BT's				
Obj.					Found				
Subsequent Corner Restoration					Evidence of Subsequent Corner Restoration Found				
Date Surveyed	By				Date of Search	By			
Where Filed or recorded:					Monument Found				
Book:	Page								
Monument Set									
BT's Species	Dia	Bearing	Dist		Species	Dia	Bearing	Dist	
Ref.					BT's				
Obj.					Found				

OTHER EVIDENCE

Describe corner location relative to nearby features and how to reach the corner location - note fences roads, timber, streams, topo changes, etc: MONUMENT
IS ON THE NORTH EDGE OF BROAD FLAT SK-NW RIDGE
TOP. A PINE STAND IS TO THE SK + SW. STAND TO
THE SK HAS MANY STORM-BLOWN DOWN TREES
A CLEARED AREA ON PRIVATE LAND OF RIDGETOP IS
APPROXIMATELY 300 FEET WEST

Sketch of Monument

PERPETUATION RECORD

Monument: Describe new monument set, or work done to preserve existing monument.

CORNER DIAGRAM

Accessories: Describe new Bt's and/or witness objects established or work done to preserve existing evidence

Photo Identified

Photo #

Strip/Series

Pinpricked

Manhours in Search

Corner Recordation

Certificate prepared:

Yes

No

Filed or recorded in County

Records: Date:

Book: Page:

Corner Record by: Name:

Date:

Robert J. Stone
8/14/97

MONUMENT RECORD

I - 17



STATE OF INDIANA - COUNTY OF MONROE

SECTION 20,21,28,29, TOWNSHIP 7 NORTH, RANGE 1 EAST

MONUMENT DESCRIPTION & REMARKS

THE STONE WAS LEFT IN PLACE AND NEW REFERENCES WERE MADE.

RECOVERY TIE DRAWING

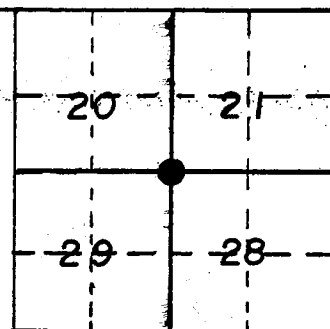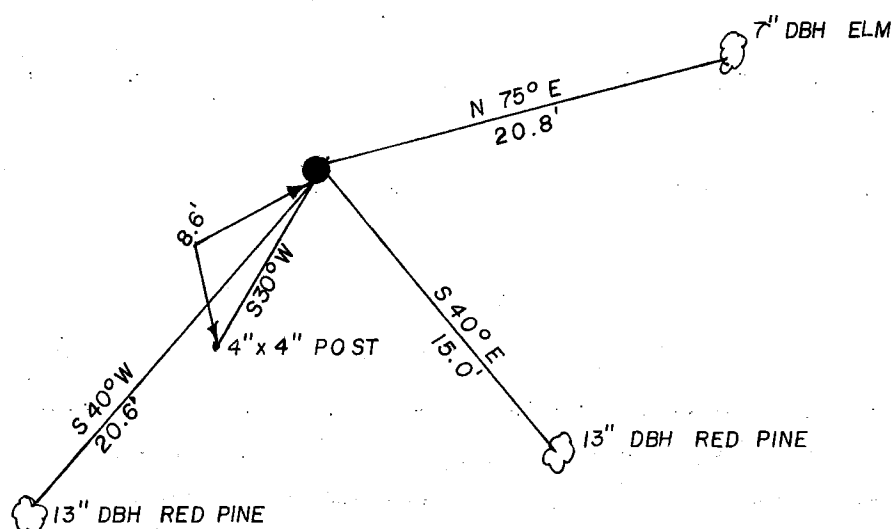

(●) AT CORNER



NOT TO SCALE

STATE OF INDIANA

COUNTY OF MONROE

I, ANDREW J. SOBIECH HEREBY CERTIFY THAT THIS DOCUMENT WAS PREPARED UNDER MY DIRECTION IN ACCORDANCE WITH THE PROVISIONS OF SECTION 17-3-64-4 - 17-3-64-8 OF THE INDIANA CODE, BEING ACTS OF 1965, CHAPTER 319; AND THE ABOVE DATA IS GIVEN UNDER MY HAND AND SEAL THIS 14 DAY OF MAY, 1974 A.D.

SPACE
RESERVED
FOR
RECORDING
OFFICER.INDIANA REGISTERED LAND SURVEYOR NO. S-0143

OR

UNITED STATES GOVERNMENT AGENCY

TOWNSHIP:

Polk

CORNER I.D.

I - 17

TITLE

R9-5680-14 (5/1/64) H. C. MILLER CO., MILWAUKEE 447802

CERTIFIED LAND CORNER RESTORATION

State of Indiana }
County of Monroe } ss.

I, Andrew J. Sobiech, do hereby certify that on the 14 day of May, 1974, I found evidence of the Section corner of Sections 20-21-28-29 Township 7 North, Range 1 East, Second Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restore

Original monument was a wood post set in 1814.

Original Witnesses:

W. Oak	B. Oak
30' DBH	18"
S 81° E	N 61° W
9 lks	9 lks

Replaced stone
w/ pipe in
1978
Need new certificate


Description of corner evidence found:

Found sandstone 2"x10" 4" high, marked with a + on top, and lying 12' east of fence corner. The fences run from the north and west and intersect in a 10" DBH hickory at the north edge of a pine plantation.

Description of monument and accessories I established to perpetuate the original location of this corner:

I left the stone in place and made the following new witnesses:

4"x4" Post	Elm	Red Pine	Red Pine
S 30° W	7" DBH	13" DBH	13" DBH
8.6 feet	N 75° E	S 40° W	S 40° E
	20.8 feet	20.6 feet	15.0 feet

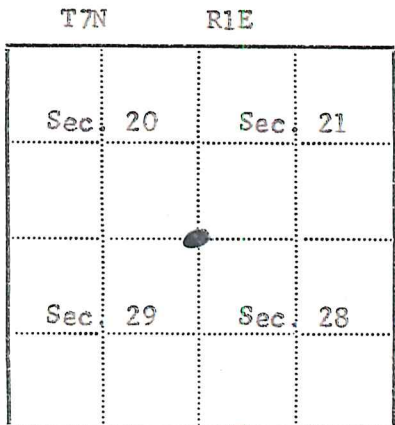

Field Assistant
Resident witnesses

Henry Deaton - U.S. Forest Service

Dated at Brownstown Indiana, this 7 day of May 1975.

Signature Andrew J. Sobiech Title R.L.S.
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. S=0143


Office of _____ County of _____
I hereby certify that the within instrument was filed in this office for record on the _____ day of _____, 19____, and was filed in Book No. _____ Page No. _____ of County Records.

Signature _____ Title _____

Township 7 North, Range 1 East, Section 20, 21, 29, 28, Index No. R-9, Page No. _____

Index No. R-9 (Alphabetical - Numerical)
 LAND CORNER RECORD (RECTANGULAR SURVEYS)
 R9-7150-4 (Rev. 6/13/67) GPO 906-924
 T. 7N R. 1E Mer. N.F. Hootie County Monroe State Ark
 Section 20 Corner common to sections 20, 21, 28 and 29

EXISTING SURVEYS	
Original Government Survey Year surveyed <u>1865</u> Original monument <u>Wood Post</u> (Wood post, stone, pile of stones, pipe, etc.) Bearing Trees Species <u>W. Oak</u> <u>B. Oak</u> Diameter <u>30"</u> <u>18"</u> Bearing <u>S 81° E</u> <u>N 61° W</u> Distance <u>9 1/2</u> <u>9 1/2</u>	Original Evidence Found Year of search _____ By _____ Monument found _____ Original Bearing Trees Found Species _____ Diameter _____ Bearing <u>N 04° E</u> Distance _____
Subsequent Corner Restoration Year surveyed _____ By _____ Where filed or recorded _____ Monument _____ (Original, concrete post, iron rod, etc.) Bearing Trees, Reference Objects Species _____ Diameter _____ Bearing _____ Distance _____	Evidence of Subsequent Corner Restoration Found Year of search <u>1973</u> By <u>D. Munter & H. Denton</u> <u>Found stone 2' x 12" - 4' x 4" and</u> <u>planted in ground 12' East of fence</u> <u>corner. Fence corners in 10" DBH Hickory</u> <u>North edge of pine plantation</u> <u>Fence from N.W. meet near stone</u> Bearing Trees, Reference Objects _____ _____ _____ _____

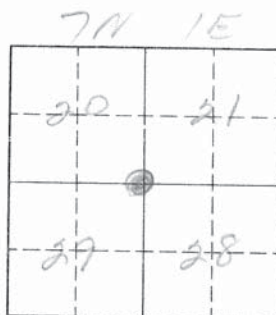

Sketch
 ○ Corner ▨ F.S. Land

Relation of Evidence to Record Features Along Section Lines
 Section line to sections _____
 Object _____
 Record distance _____
 Measured distance _____

Other Evidence
 Describe evidence of use and occupation such as roads, fences, clearings, timber cutting lines, plantations, etc.. Cite source of testimony if any. _____

Perpetuation Record
 Monument and accessories established. Include brief description of area. _____

old F.S. card (reads - Sandstone App. 12' E of old fence corner
Fence corners on 10" DBH Hickory smoothbark

- Need to leave stone in place make new witnesses

Certified corner restoration certificate prepared: Yes _____ No _____
 Filed in county records at _____ Date _____ County Document No. _____
 Identified on aerial photo No. _____ Which is filed at _____

- At time of search:
- Did you have the record description?
 Yes ☒ No _____
 - How was search area located?
 Pacing, chaining, photos, maps, etc. _____
 - Man hours spent in search 2 hr.
 - Do you think additional search might recover evidence? Yes _____ No _____
 - Signature H. Denton

LAND CORNER RECORD (Rectangular)		5680-2
1. T <u>7N</u> R <u>1E</u> No. _____ Cor. _____ Mer. <u>2d</u> State <u>Indiana</u> N.F. <u>Hoosier</u> Dist. <u>B'town</u>		
2. Corner Status	3. Original Description _____ Vol. _____ Page _____ Where Recorded _____	
28	4. Description of Corners: Sandstone	
7. Photo Identification Photo No. _____ Ident. By: _____	5. Investigation Notes: <i>Sandstone approx. 12' East of old fence corner fence corners on 10" dia. setting with mark</i> Near old fence corner	
8. Plane Coordinate Position Data State _____ Zone _____ X _____ Y _____ Estab. By _____ Field Book No. _____ Where Filed _____		
9. Evaluation Authentic _____ Needs Verif. _____ Monument _____ Re-estab. _____ Survey _____ Land Status _____	6. Signed _____ Title _____ Date _____	

PERPETUATION RECORD	
10. Monument:	
II. Accessories	
12. Set By _____ Title _____ License _____ Agency _____ Date _____	Field Book _____ Page _____ Volume _____ Page _____ 13. Recorded By _____ (Date) (City) (County) (State)
14. Remarks:	